


## SERVICE BULLETIN

August 16, 2011

Dear Batting Cage Owners and Operators,

ABC has received some reports from the field that the set screws for the MA30 x 5/8 motor pulley on the "Pastime" model pitching machines are coming loose and the pulley begins to slide back and forth on the motor shaft.

ABC recommends all MA30 x 5/8 motor pulley set screws on "Pastime" pitching machines be secured with Blue Loctite which is available at most auto part stores. In addition, we suggest you install a second 5/16-18 x 5/16 set screw on top of the original set screws that secure the pulley to the motor shaft. These set screws should be checked for tightness on a monthly basis.

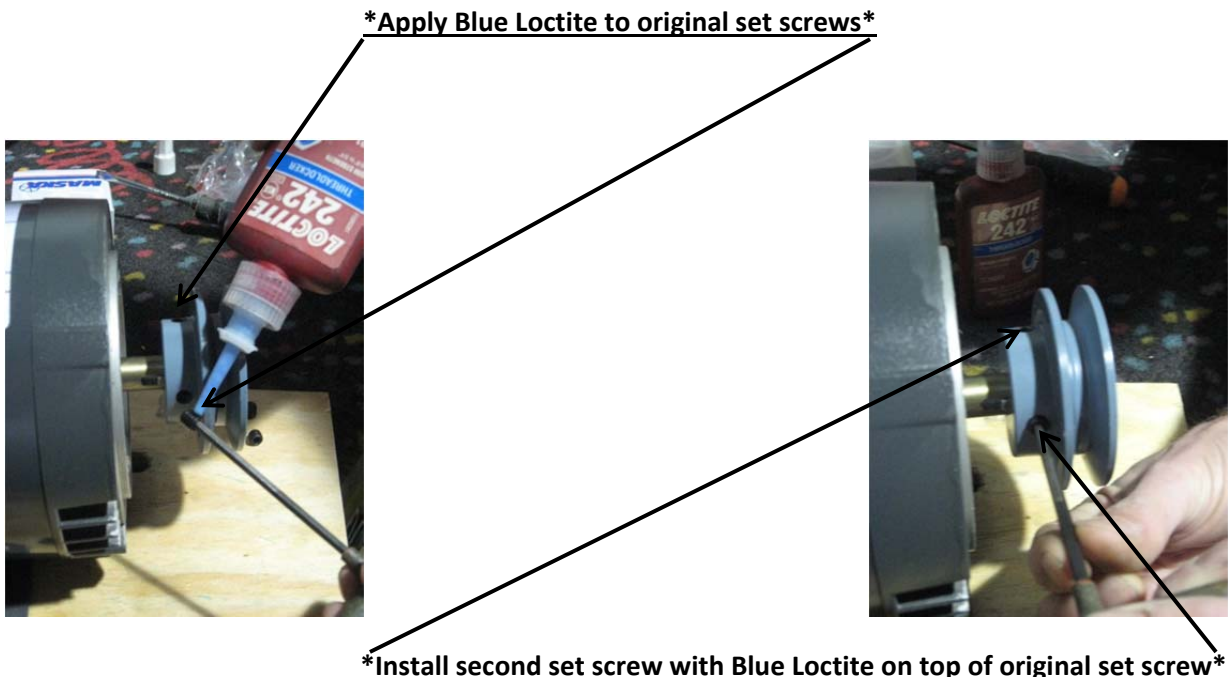

Thank you for your attention to this matter and if you have any questions please contact the Service Department at ABC.